PAGE: 1 PRINT DATE: 08/09/96

FAILURE MODES EFFECTS ANALYSIS (FMEA) — CIL HARDWARE

NUMBER: 05-6N-2057 -X

SUBSYSTEM NAME: EPD&C - AUXILIARY POWER UNIT (04-2)

REVISION: 2 01/13/94

	PART DATA		
	PART NAME VENDOR NAME	PART NUMBER VENDOR NUMBER	
LRU	: AFT LCA 1	MC450-0057-0001	
LRU	: AFT LCA 2	MC450-0058-0001	
LRU	: AFT LCA 3	MC450-0059-0001	
SRU	: DIODE	JANTXV1N5551	

EXTENDED DESCRIPTION OF PART UNDER ANALYSIS:

DIODE, GSE ISOLATION (3 AMP) - AUXILIARY POWER UNIT (APU) HEATERS TANK! FUEL LINE 1, 2, 3 (A AND B) POWER CIRCUIT

REFERENCE DESIGNATORS:

54V76A121(12)

55V76A122(12) 56V76A123(12)

QUANTITY OF LIKE ITEMS: 36

THIRTY SIX

FUNCTION:

PROVIDES ISOLATION BETWEEN THE PREFLIGHT TEST BUS AND COMMAND CONTROL CIRCUITS FOR THE TANK AND FUEL LINE HEATERS.

PRINT DATE: 08/12/96 PAGE 2

FAILURE MODES EFFECTS ANALYSIS FMEA -- CIL FAILURE MODE

NUMBER: 05-6N-2057-02

REVISION#: 03

08/01/96

SUBSYSTEM NAME: EPD&C - AUXILIARY POWER UNIT (04-2)

LRU: AFT LCA 1, 2, 3

CRITICALITY OF THIS FAILURE MODE: 1R3

ITEM NAME: DIODE

FAILURE MODE:

SHORT (END TO END)

MISSION PHASE:

PL PRE-LAUNCH

LO LIFT-OFF OO ON-ORBIT DO DE-ORBIT

LS LANDING/SAFING

VEHICLE/PAYLOAD/KIT EFFECTIVITY:

102 COLUMBIA

103 DISCOVERY **ATLANTIS** 104 **ENDEAVOUR** 105

CAUSE:

STRUCTURAL FAILURE (MECHANICAL STRESS, VIBRATION), CONTAMINATION. ELECTRICAL STRESS, THERMAL STRESS, PROCESSING ANOMALY

CRITICALITY 1/1 DURING INTACT ABORT ONLY? NO

REDUNDANCY SCREEN

A) FAIL

B) N/A

C) PASS

PASS/FAIL RATIONALE:

FIRST FAILURE NOT DETECTABLE DURING GROUND TURNAROUND SINCE THE SHORT FAILURE MODE OF THIS DIODE DOES NOT EFFECT THE FUNCTIONAL OPERATION OF THE SYSTEM UNLESS THERE ARE ADDITIONAL ASSOCIATED FAILURES.

8) FIRST FAILURE NOT DETECTABLE DURING FLIGHT SINCE THE SHORT FAILURE MODE OF THIS DIODE DOES NOT AFFECT THE FUNCTIONAL OPERATION OF THE SYSTEM UNLESS THERE ARE ADDITIONAL ASSOCIATED FAILURES. SCREEN IS "N/A" SINCE OPERATIONAL STATUS OF HEATER SWITCH CONTACTS AND THERMOSTAT IS READILY VERIFIABLE.

C)

PAGE: 3 PRINT DATE: 08/09/96

FAILURE MODES EFFECTS ANALYSIS (FMEA) -- CIL FAILURE MODE NUMBER: 05-6N-2057- 02

- FAILURE EFFECTS -

(A) SUBSYSTEM:

DEGRADATION OF REDUNDANCY AGAINST LOSS OF CONTROL BUS ISOLATION AND SWITCH COMMAND ISOLATION.

(B) INTERFACING SUBSYSTEM(S):

NO EFFECT - FIRST FAILURE

(C) MISSION:

NO EFFECT - FIRST FAILURE

(D) CREW, VEHICLE, AND ELEMENT(S):

NO EFFECT - FIRST FAILURE

(E) FUNCTIONAL CRITICALITY EFFECTS:

POSSIBLE LOSS OF CREW/VEHICLE AFTER THREE OTHER FAILURES (SERIES GSE ISOLATION DIODE FAILS SHORT, ONE CONTACT SET OF THE SWITCH FAILS CLOSED, CONTACTS OF A THERMOSTAT FAILS CLOSED) WHICH POWERS HEATERS CONTINUOUSLY RESULTING IN FUEL DECOMPOSITION AND LINE RUPTURE.

-DISPOSITION RATIONALE-

(A) DESIGN:

REFER TO APPENDIX F. ITEM NO. 4 - DIODE

(B) TEST:

REFER TO APPENDIX F, ITEM NO. 4 - DIODE

GROUND TURNAROUND TEST NONE. THE GSE ISOLATION DIODE IS A COMPONENT INTERNAL TO THE AFT LCA'S 1, 2, AND 3 WHICH WOULD REQUIRE DISASSEMBLY OF THE LCA'S FOR DIRECT OMRSD TESTING. THIS TYPE OF PROCEDURE IS IMPRACTICAL AND INVASIVE.

(C) INSPECTION:

REFER TO APPENDIX F, ITEM NO. 4 - DIODE

PAGE: 4 PRINT DATE: 08/09/96

FAILURE MODES EFFECTS ANALYSIS (FMEA) - CIL FAILURE MODE

NUMBER: 05-6N-2057-02

(D) FAILURE HISTORY:

REFER TO APPENDIX F, ITEM NO. 4 - DIODE

(E) OPERATIONAL USE:

NONE

- APPROVALS -

EDITORIALLY APPROVED EDITORIALLY APPROVED TECHNICAL APPROVAL : RI : J\$C

: VIA JSC

96-CIL-010